

DEPARTMENT OF TRANSPORTATION**DIVISION OF ENGINEERING SERVICES**

Office of Structural Materials

Quality Assurance and Source Inspection



Bay Area Branch
690 Walnut Ave. St. 150
Vallejo, CA 94592-1133
(707) 649-5453
(707) 649-5493

Contract #: 04-0120F4Cty: SF/ALA Rte: 80 PM: 13.2/13.9File #: 69.28**WELDING INSPECTION REPORT****Resident Engineer:** Pursell, Gary**Address:** 333 Burma Road**City:** Oakland, CA 94607**Report No:** WIR-012553**Date Inspected:** 17-Feb-2010**Project Name:** SAS Superstructure**OSM Arrival Time:** 700**Prime Contractor:** American Bridge/Fluor Enterprises, a JV**OSM Departure Time:** 1900**Contractor:** Zhenhua Port Machinery Company, Ltd (ZPMC), Changxing Island **Location:** Shanghai, China**CWI Name:** Du Zhi Qun**CWI Present:** Yes No**Inspected CWI report:** Yes No N/A**Rod Oven in Use:** Yes No N/A**Electrode to specification:** Yes No N/A**Weld Procedures Followed:** Yes No N/A**Qualified Welders:** Yes No N/A**Verified Joint Fit-up:** Yes No N/A**Approved Drawings:** Yes No N/A**Approved WPS:** Yes No N/A**Delayed / Cancelled:** Yes No N/A**Bridge No:** 34-0006**Component:** Tower**Summary of Items Observed:**

On this day CALTRANS OSM Quality Assurance (QA) Inspector Shailesh Gaikwad was present during the times noted above for observations relative to the fabrication of the SAS Superstructure being performed by Zhenhua Port Machinery Company (ZPMC) at Changxing Island in Shanghai, China. QA observed and/or found the following:

This QA Inspector observed the following work in progress:

BAY 10

Repair Welding:

This QA Inspector observed ZPMC qualified welding personnel identified as 057258, Perform Shielded Metal Arc Welding (SMAW) on North Tower lift 4 B/C corner joint. The weld identified as NSTL4-3B/L-5B, Y location is 26750. ZPMC CWI Identified as Gang Liang Zhu, with Temporary welding repair report. The welding parameters as measured using QC's calibrated instrument appeared to be in general compliance with WPS-345-SMAW-2G (2F) - Repair. For more information see attached photos.

Repair Welding:

This QA Inspector observed ZPMC qualified welding personnel identified as 066236, Perform Shielded Metal Arc Welding (SMAW) on North Tower lift 4 B/C corner joint. The weld identified as NSTL4-3B/L-5B, Y location is 12100. ZPMC CWI Identified as Gang Liang Zhu, with Temporary welding repair report. The welding parameters as measured using QC's calibrated instrument appeared to be in general compliance with WPS-345-SMAW-2G (2F) - Repair. For more information see attached photos.

WELDING INSPECTION REPORT

(Continued Page 2 of 3)

Repair Welding:

This QA Inspector observed ZPMC qualified welding personnel identified as 040434, 066733 Perform Flux Core Arc Welding (FCAW) on North Tower lift 4 C/D corner joint. The weld identified as NSTL4-3B/L-1A/B, near double Diaphragm 123M and 127M. Y location is 23670 to 235530mm and 19380 to 18590mm. ZPMC CWI Identified as Du Zhi Quin , with Critical welding repair report , CWR –T-CWR533. The welding parameters as measured using QC's calibrated instrument appeared to be in general compliance with WPS-345-FCAW-1G (1F) - Repair. For more information see attached photos.


BAY 11:

Repair Welding:

This QA Inspector observed ZPMC qualified welding personnel identified as 066361, 066038 Performing Shielded Metal Arc Welding (SMAW) on West Tower lift 4 B/C corner joint from Inside. The weld identified as WSTL4-2B/L-58B, In Between double Diaphragm 131M to 135M, and 123M to 127M. ZPMC CWI Identified as Lilin, with Critical welding repair report, CWR –T-CWR569. The welding parameters as measured using QC's calibrated instrument appeared to be in general compliance with WPS-345-SMAW-2G (2F) – Repair. For more information see attached photos.



This QA Inspector observed ZPMC qualified welding personnel identified as 042195. Perform Submerged Arc Welding (SAW) on Angle connection Plate. Joint identified ND1-SA4-68-135M-8-1B, ED1-SA4-68-139M-1-1B, ED1-SA4-68-139M-2-1B, ZPMC QC Identified as Mao Bin Bin. The welding parameters as measured using QC's calibrated instrument appeared to be in general compliance with WPS-B-T-3221-Tc-U5-S-1.

Unless otherwise noted, all work observed on this date appeared to be in general compliance with the applicable contract documents.

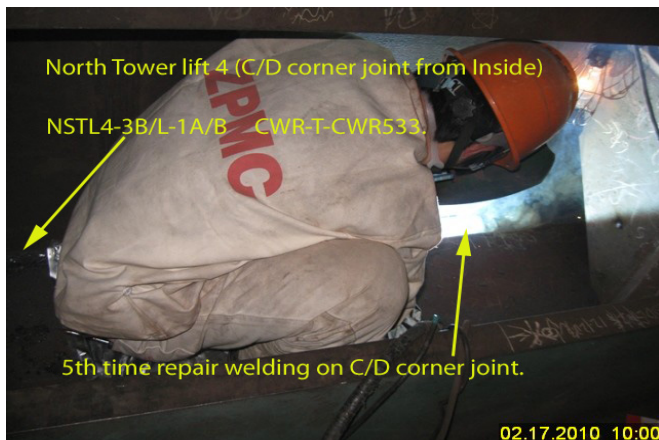

WELDING INSPECTION REPORT

(Continued Page 3 of 3)

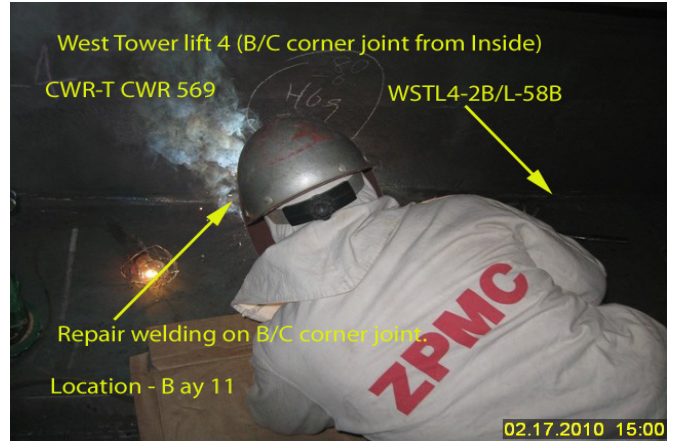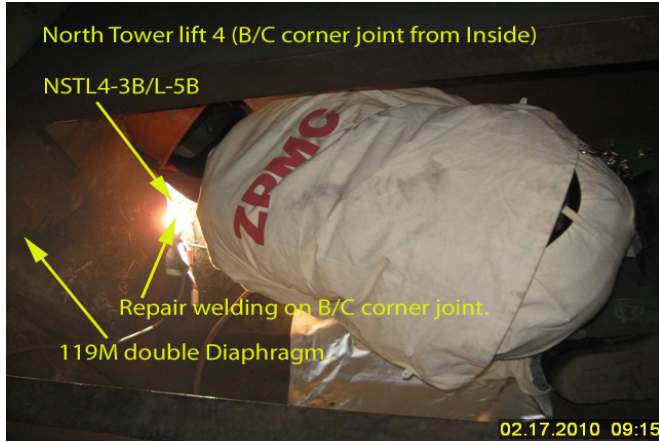

Summary of Conversations:

Only general conversation was held between QA and QC concerning this project.

Comments

This report is for the purpose of determining conformance with the contract documents and is not for the purpose of making repair or fit for purpose recommendations. Should you require recommendations concerning repairs or remedial efforts please contact Skyler Guest phone: 15000422360, who represents the Office of Structural Materials for your project.

Inspected By: Gaikwad,Shailesh

Quality Assurance Inspector

Reviewed By: Clifford,William

QA Reviewer